

USER'S GUIDE

Installation & Operation Instructions

Doppler Flow Meter

Model DFM 5.0

Manual Series A.8.11

Note: This page has been left blank intentionally.




INDEX

CONNECTIONS
KEYPAD SYSTEM
CALIBRATION MENU
MESSAGE
STATUS
PASSWORD9
UNITS/MODE
CALIBRATION
RELAY PARAMETERS
SPECIAL FUNCTIONS
SENSOR MOUNTING
ENCLOSURE INSTALLATION
SYNCHRONIZATION
FIELD TROUBLESHOOTING
COMMON QUESTIONS AND ANSWERS
APPLICATIONS HOTLINE
PRODUCT RETURN PROCEDURE
FLOW METER DATA SHEET
APPENDIX A – OPTIONS
DATA LOGGING
SPECIFICATIONS
APPENDIX B - CONVERSION TABLE
PIPE CHARTS

IMPORTANT NOTE: This instrument is manufactured and calibrated to meet product specifications. Please read this manual carefully before installation and operation. Any unauthorized repairs or modifications may result in a suspension of the warranty.

If this product is not used as specified by the manufacturer, protection may be impaired.

Available in Adobe Acrobat pdf format





CONNECTIONS:

POWER INPUT: The standard model requires AC power input between 100 to 240 VAC 50/60Hz . No adjustments are necessary for voltages within this range. Connect L (Live) N (Neutral) and AC Ground.

Optional DC input model requires 9-32 VDC/9 Watts. Connect to + and - terminals.

Optional Thermostat and Heater modules are available rated for 115 VAC or 230 VAC.

IMPORTANT NOTE: To comply with CSA/UL electrical safety standards, AC power input and relay connection wires must have conduit entry to the instrument enclosure. Installation requires a switch, overcurrent fuse or circuit breaker in the building (in close proximity to the equipment) that is marked as the disconnect switch.




Risk of electric shock. Loosen cover screw to access connections. Only qualified personnel should access connections.

Note: Use of instrumentation over 40°C ambient requires special field wiring.

Note: User replaceable fuse is 2 Amp 250V (T2AL250V).



CONNECTIONS

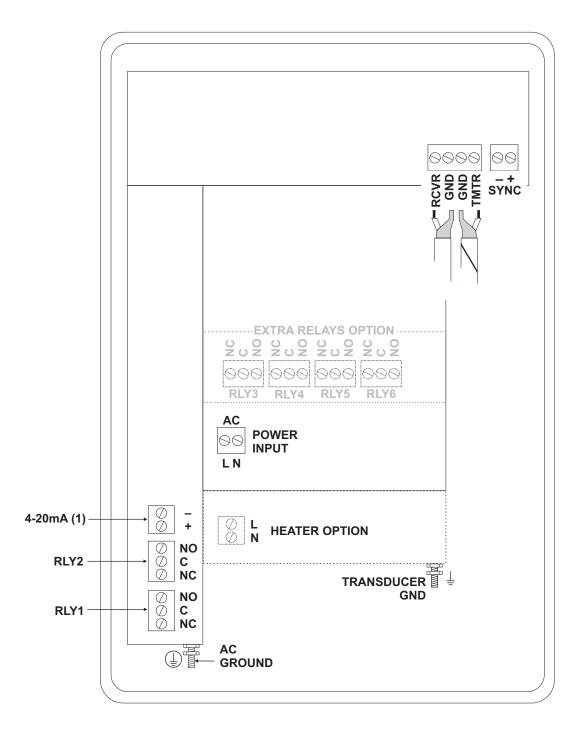




KEYPAD SYSTEM


The following diagram shows the DFM 5.0 menu system. Arrows show the four directions to leave a menu box. Pressing a corresponding keypad arrow will move to the next item in the direction shown. Move the cursor (underline) under numerals and increase or decrease numerals with the \clubsuit and \clubsuit keys.

To store calibration values permanently (even through power interruptions), press the \checkmark .

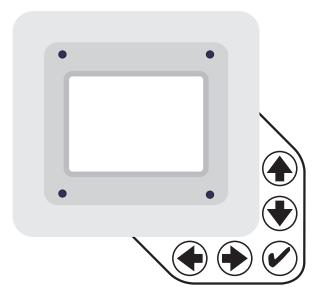



CALIBRATION MENU

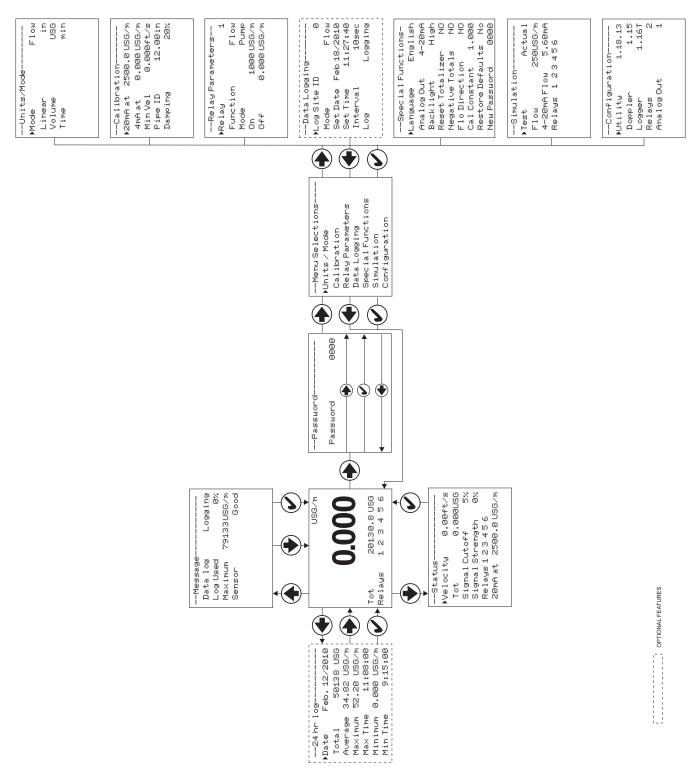





USG/m **0.0000** Tot 20130.8 USG Relays 1 2 3 4 5 6

Message	
Data log	Logging
Log Used	0%
Maximum	79133USG/m
Sensor	Good
1	

RUN

The main display shows the units selected from the Units/Mode menu, Flow or Velocity rate being measured, TOTALIZER and RELAY states. The DFM 5.0 will start-up with this display and will return to this screen after a timeout if keys are not pressed in other menus.

MESSAGE

Press \clubsuit from the RUN display to view status of the data logger and error/warning messages provided by the instrument. The word Message will appear on the RUN display if error messages are being generated by the instrument. Refer to the manual section Error/Warning Messages for a description. Press \checkmark to return to the main display.

STATUS

Press \clubsuit from the RUN display to view instrument status. Velocity will be displayed in ft/sec or m/sec.

Tot	Displays the current totalizer reading.	
Signal Cutoff	Adjust the setting in percent to suppress flow readings at zero flow when fluid swirling or pipe vibration may cause the instrument to continue reading. Example: Signal Cutoff at 5% will force the display and outputs to zero when signal strength drops below 5%.	
Signal Strength	Displays percentage of signal being received by the ultrasonic sensor.	
Relays	Energized relays will display as a white character on a black background.	
20mA at	Displays the flow rate set as 20mA in the Calibration menu. Press \checkmark to return to the main display.	


--Status-----Velocity 0.00ft/s Tot 0.000USG Signal Cutoff 5% Signal Strength 0% Relays 1 2 3 4 5 6 20mA at 2500.0 USG/m



24 hr 1	og
▶Date	Feb. 12/2010
Total	50138 USG
Average	34.82 USG/m
Maximum	52.20 USG/m
Max Time	11:08:00
Minimum	0.000 USG/m
Min Time	9:15:00

24 HR LOG (Data Logging option only)

Press \blacklozenge from the RUN display to view a formatted flow report from instruments with a built-in data logger. Press \clubsuit to scroll down one day or repeatedly to scroll to a specific date. Up to 365 days can be stored. Newest date will overwrite the oldest. Press \checkmark to return to the main display.

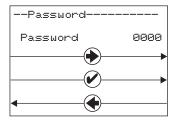

PASSWORD

The password (a number from 0000 to 9999) prevents unauthorized access to the Calibration menu.

From the Run display press the \Rightarrow key to get to Password. Factory default password is 0000 and if it has not been changed press the \checkmark to proceed to the Menu Selections screen.

If a password is required, press \blacklozenge to place the cursor under the first digit and \clubsuit or \blacklozenge to set the number, then \blacklozenge to the second digit, etc. Press \blacklozenge or \checkmark to proceed to the Menu Selections screen.

A new password can be stored by going to Special Functions/New Password.



Units/Mode		
▶Mode	Flow	
Linear	in	
Volume	USG	
Time	min	

--Units/Mode-----

Flow

<u>i n</u>

ft M MM

Mode

▶Linear

UNITS/MODE

From Mode press the \Rightarrow and then the \uparrow or \clubsuit to select Flow or Velocity. Flow mode displays the flow rate in engineering units (e.g. gpm, litres/sec, etc.) Press the \checkmark to store your selection then the \clubsuit to the next menu item and \Rightarrow to enter.

From \blacktriangleright inear press the \Rightarrow key and then the \uparrow or \clubsuit to select your units of measurement. Press the \checkmark to store your selection.

Press the \checkmark key to move the \triangleright symbol to each subsequent menu item and the \checkmark to save your selections.

Note: the volume selection "bbl" denotes U.S. oil barrel.

Press \blacklozenge or \checkmark to return to the Menu Selections screen.

Units/Mode-	
♦Volume	US <u>G</u> ft3 bb1 m3 IMG IG
	USMG

Units/Mode		
Mode	Flow	
Linear	in	
Volume	USG	
▶Time	se <u>c</u>	
	day	
	hr	
	min	





Calibration			
▶20mA at	2500.0USG/m		
4mA at	0.000 USG/m		
Min Vel	0.000ft/s		
Pipe ID	12.00in		
Damping	20%		

CALIBRATION

Press the \clubsuit to \blacktriangleright Calibration and \Rightarrow to enter. Use \clubsuit or \clubsuit to position \triangleright before each menu item and \Rightarrow to enter. When settings are completed press \checkmark to store and return to the Calibration menu.

20mA at (5V F 1 o)	Press \Rightarrow then \clubsuit or \bigstar to change the numbers and decimal point. Use this menu to set the corresponding flow rate that will be represented by 20mA analog output. If maximum flow is unknown, enter an estimated flow rate and observe actual flow to determine the correct maximum value. Any velocity or flow rate up to +40 ft/sec (12.2 m/sec) may be selected.
4mA at (ØV F1o)	Press \clubsuit or \clubsuit to set the flow rate corresponding to 4mA analog output. This setting may be left at zero flow (or velocity or can be raised to any value less than the 20mA setting, or lowered to any velocity or corresponding flow rate down to -40 ft/sec (-12.2 m/sec).
Min Vel	Press \Rightarrow and enter a minimum velocity cutoff. Forward and reverse velocities less than $Min V \in 1$ will be forced to zero.
Pipe ID	Place the cursor under the digits and then \clubsuit or \bigstar to change the numbers and decimal point. $\Pr \models ID$ should be entered as the exact inside diameter of the pipe where the sensor is mounted. Refer to the Pipe Charts Appendix in this manual for inside diameter of common pipe types and sizes.
Damping	Increase damping to stabilize readings under turbulent flow conditions. Decrease for fast response to small changes in flow. Damping is shown in percentage (maximum is 99%). Factory default is 20%.


Press ✓ from the Units/Mode display to return to Menu Selections.





Relay Par ▶Relay	rameters 1	RELAY PARAMETERS	
Function Mode On Off	Flow Pump 1000 USG 0.000 USG	Relay	Press \Rightarrow and \clubsuit or \clubsuit to select a corresponding relay number (2 relays are standard, 4 additional are optional).
		Function	Press ♣ or
		Flow	Mode Select Pump, Low Alarm or Hi Alarm.
			Pump mode provides separate On/Off settings where the relay will energize at one flow rate and de-energize at another.
			\Box_{T} Position the cursor under the numerals and press \clubsuit or \clubsuit to set digits to the required relay \Box_{T} set point.
			Off set digits to the required Off set point.
			Low Alarm mode relay will energize at a programmable flow rate and remain energized with flow below the set point. When flow rises above the set point, the relay will de-energize.
			Hi Alarm mode relay will energize at a programmable flow rate and remain energized with flow above the set point. When flow falls below the set point, the relay will de-energize.
		Pulse	Press and set digits to the flow volume increment required between relay pulses. Use this feature for remote samplers, chlorinators or totalizers. Minimum time between pulses is 2.25 seconds and pulse duration is 350 milliseconds.
			Return to $Relay$ and change settings for each relay number.

Press ✓ to return to Menu Selections.





--Special Functions-

DATA LOGGING (OPTIONAL)

Refer to Options section of this manual.

SPECIAL FUNCTIONS

opecial Functions-		
▶Language English		
AnalogOut 4-20mA	Language	Select English, French or Spanish
Backlight High		Scient English, Thenen of Spanish
Reset Totalizer NO		
Negative Totals NO	Analog Out	Select 4-20mA or 0-5V mode for the analog
FloDirection NO		output.
CalConstant 1.000		ouipui.
Restore Defaults No		
New Password 0000	Backlight	Select High, Medium or Low for
		continuous backlight.
		continuous backright.
Special Functions-		Select KeyHi/Lo for high backlight for 1
Language English		minute after a keypress and then $L \circ$ backlight until
▶Backlight Hig <u>h</u>		
Medium		a key is pressed again.
Key Hi/Lo Key High		Select KeyHigh, Med or Low for
Key Med		•
Key Low		backlight for 1 minute after a keypress and then
Off		backlight off until a key is pressed again.
	Reset Totalizer	Press \Rightarrow and select $\forall = \exists$ to erase and restart the
		totalizer at zero.
	Negative Totals	Select $\forall e \equiv$ to have reverse flow readings
	_	deducted from the totalizer. Select No to totalize
		forward flow only and ignore reverse flow.
	FloDirection	Select \Box_{T} to enable flow direction
		measurement. Select Off to disable flow
		direction measurement. Select Invent to
		invert the sense of the flow measurement.
		myore the sense of the now measurement.
	C-1 C+	
	Cal Constant	Set to 1.000 for SE4-A transducer and QZ02L.
	Restore Defaults	Select $\forall \in \exists$ and press \checkmark to erase all user settings
		and return the instrument to factory default
		settings.
	New Password	Select any number from 0000 to 9999 and press \checkmark .
		Default setting of 0000 will allow direct access to
		the calibration menus. Setting of any password
		greater than 0000 will require the password to be
		entered to access the calibration menus.

Press ✓ to return to Menu Selections.



--Simulation-----Test Actual Flow 250USG/m 4-20mAFlow 5.60mA Relays 1 23 4 5 6

SIMULATION

Exercises the 4-20mA (0-5V) output, digital display and control relays.

Test Select Maximum and press ✓ to simulate maximum Flow or Velocity and to output 20mA (5V) to the analog channel.

Select Minimum and press \checkmark to simulate minimum Flow or Velocity and to output 4mA (0V) to the analog channel.

To simulate measurements between minimum and maximum set Test to Actual and then enter for the flow measurement. The analog output and control relays will respond to the simulated value.




SENSOR MOUNTING LOCATION

The position of the sensor is one of the most important considerations for accurate Doppler flow measurement. The same location guidelines apply to Doppler as most other types of flow meters.

Before permanently mounting a Doppler sensor onsite testing is recommended to determine optimum mounting position. Use the sensor coupling compound (supplied with each Greyline flow meter, or petroleum gel, acoustic compound or electrocardiograph gel). Take several readings around the axis of the pipe and then at several points upstream and downstream from the selected position, checking for consistent readings. Avoid high or low reading areas. Mount the sensor where consistent (average) readings were obtained or continue testing on another pipe section.

VERTICAL OR HORIZONTAL PIPE - Vertical pipe runs generally provide evenly distributed flow. On Horizontal pipes and liquids with high concentrations of gas or solids, the sensor should be mounted on the side (3 or 9 o'clock position) to avoid concentrations of gas at the top of the pipe, or solids at the bottom. For liquids with minimal gas bubbles (e.g. potable water) the sensor should be mounted on the top of a horizontal pipe (12 o'clock position) to obtain the best signal strength.

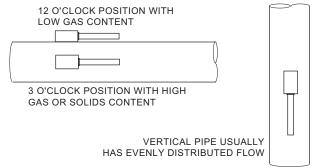

VELOCITY INCREASING DEVICES: Generally the sensor must be mounted away from flow disturbances such as valves, pumps, orifice plates, venturis or pipe inlets and discharges which tend to increase flow velocity. Velocity increasing devices often cause cavitation, or rapid release of gas bubbles, and readings both up and downstream may show much higher velocity. As a guideline, mount the sensor at least 20 diameters upstream or 30 diameters downstream from velocity increasing devices.

Required distance from a velocity increasing device will vary in applications depending on the flow velocity and the characteristics of the liquid itself.



TURBULENCE INCREASING DEVICES: Elbows, flanged connections and tees tend to introduce desirable conditions of an evenly distributed flow profile with some air or gases entrained in the flow. Sensor mounting 6 pipe diameters upstream and 10 diameters downstream from these disturbances is generally optimum.


The sensor is designed to mount longitudinally on a straight section of pipe. Do not attempt to mount it on bends, elbows or fittings.



SENSOR MOUNTING

Prepare an area 2" wide by 4" long (50mm x 100mm) for sensor bonding by removing loose paint, scale and rust. The objective of site preparation is to eliminate any discontinuity between the sensor and the pipe wall, which would prevent acoustical coupling.

A PC4 Sensor Mounting Kit is supplied with each Greyline flow meter. It includes recommended coupling compound in a plastic applicator and a stainless steel mounting bracket with adjustable pipe straps.

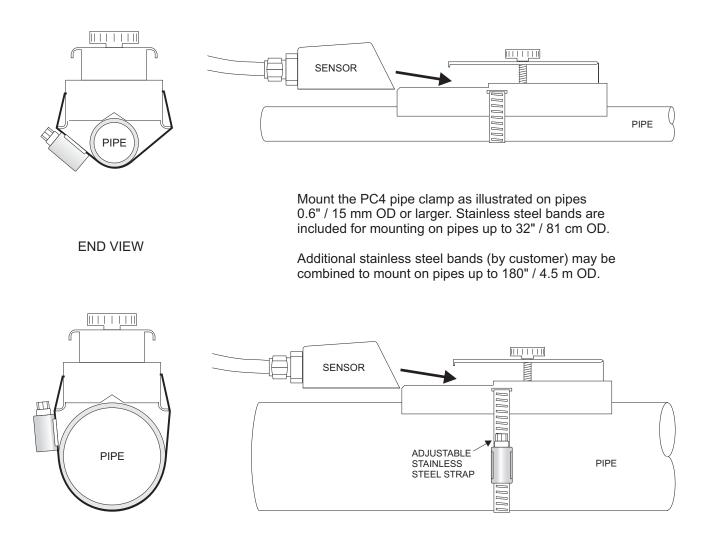




SENSOR COUPLING

For permanent or temporary bonding, the following are recommended:


- a) Dow Corning silicon compound #4 (supplied) Additional supply: order Greyline Option CC
- b) High Temperature compound (supplied with Sensor Option SE3H) Additional supply: order Greyline Option AP-1W
- c) Water-based sonic compound: Order Greyline Option CC30
- d) Electrocardiograph gel
- e) Petroleum gel (Vaseline)

The above are arranged in their order of preferred application. d & e are only good for temporary bonding at room temperature. DO NOT USE: Silicon RTV caulking compound (silicon rubber).

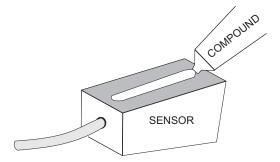

Use the PC4 pipe clamp (supplied) as illustrated above or use a loop of electrical tape for temporary mounting. Apply silicon coupling compound #4 to the coloured face of the sensor. A bead, similar to toothpaste on a toothbrush, is ideal. Do not overtighten (crush the sensor).

The sensor must be fixed securely to the pipe with coupling material between the sensor face and the pipe. Sensor installation with excessive coupling compound can result in gaps or voids in the coupling and cause errors or loss of signal. Insufficient coupling compound will create similar conditions.

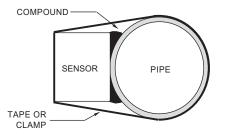


Over time temporary coupling compounds (e.g. Petroleum Gel) may gradually sag away from the sensor resulting in reduced signal strength and finally complete loss of signal. Warm temperatures, moisture and vibration will accelerate this process. Dow Corning Silicone Compound #4 as supplied with the DFM 5.0 (and available from Greyline Instruments) is recommended for semi-permanent installations.



DFM 5.0 Doppler Flow Meter

SENSOR MOUNTING/COUPLING RECOMMENDATIONS

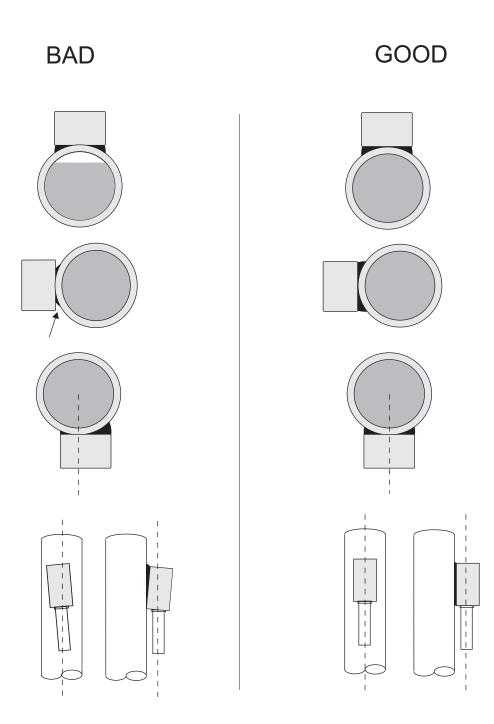




ENCLOSURE INSTALLATION

Locate the enclosure within 20 ft (6 m) of the sensor (500 ft -150 m optional). The enclosure can be wall mounted with the four mounting screws (included) or panel mounted with Option PM Panel Mount kit from Greyline Instruments.

Avoid mounting the enclosure in direct sunlight to protect the electronics from damage due to overheating and condensate. In high humidity atmospheres, or where temperatures fall below freezing, Option TH Enclosure Heater and Thermostat is recommended. Seal conduit entries to prevent moisture from entering enclosure.

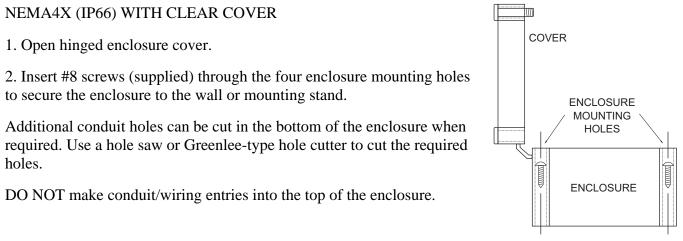

END VIEW

Note: This non-metallic enclosure does not automatically provide grounding between conduit connections. Grounding must be provided as part of the installation. Ground in accordance with the requirements of the National Electrical Code. System grounding is provided by connecting grounding wires from all conduit entries to the steel mounting plate or another point which provides continuity.

CLEANING

Cleaning is not required as a part of normal maintenance.




SYNCHRONIZATION

Synchronization may be required to prevent interference (readings with no flow or "cross talk") in applications where more than one DFM 5.0 Doppler sensor is used in close proximity. Synchronize DFM 5.0 flow meters only if sensors from separate DFM 5.0 flow meters are mounted on the same pipe.

To synchronize one or more DFM 5.0 flow meters use twisted, shielded pair cable, 22AWG or heavier. Connect SYNC + of one DFM 5.0 to the SYNC + of the next unit. And connect SYNC - of one DFM 5.0 to the SYNC - of the next unit, etc. Connect shield to Transducer GND on all units as illustrated below.


No changes in DFM 5.0 hardware setup or software are required. The instruments manage synchronization connections automatically.

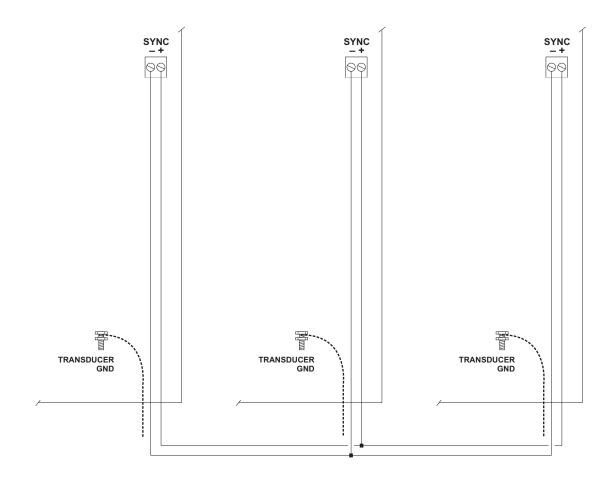



FUSE REPLACEMENT

- 1. Turn OFF power.
- 2. Loosen cover screw and open.
- 3. Remove power module.
- 4. Locate fuse on Power Board.
- 5. Replace fuse with 2 AMP/ 250V, 5 x 20mm fuse.
- 6. Reinstall power module into chassis.

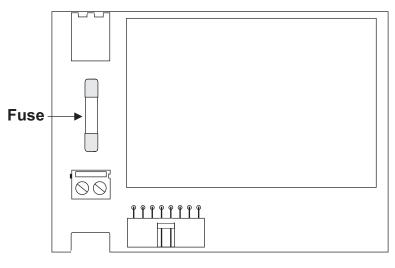

POWER MODULE



FIELD TROUBLESHOOTING

Possible Causes:	Corrective Action:
METER READING LOWER THAN EXPECTED	
Calibration Error	• Review UNITS/MODE menu and Pipe
Lower flow rate than expected	Investigate pump/valves. Compare velocity with alternate instrument
Signal not penetrating far enough into the flow stream	Relocate sensor closer to elbows or flow disturbances
Improper mounting of sensor	Reinstall Sensor with careful application of Coupling Compound
Pipe is not full	Remount Sensor on vertical pipe
METER READING WHEN THERE IS NO FLOW	
Vibration on pipe	 Adjust Status / Signal Cutoff setting Install in another location
Local electrical noise	 Ensure all Flowmeter wiring is in METAL conduit and sensor shield is properly grounded. Ensure correct power input Ground connection (<1 ohm resistance). Ensure 4-20mA Shield connected to Instrument Ground stud.
Cross talk between two or more DFM 5.0 flowmeters on same pipe	Refer to Synchronization instructions
Variable Speed Drive interference	 Follow Drive manufacturers wiring and Grounding instructions Relocate Flowmeter electronics, Sensor and wiring away from VSD
Sensor cable connections incorrect or loose	• Refer to Connections diagram. Disconnect and reconnect sensor cables ensuring that cable is properly inserted into terminals and tightened.



Possible Causes:	Corrective Action:					
METER READING ERRATIC						
Sensor mounted too close to valve, pump or elbow	• Change sensor placement. Recommended 6-10 diameters from elbows, and 30 diameters from pumps, controlling valves, orifice plates, nozzles or open pipe discharge					
NO FLOW INDICATION						
Not enough suspended particles or gases in the fluid	 Relocate sensor in more turbulent pipe section. Mount sensor at 12 o'clock position on horizontal pipe 					
Coupling compound washed out, or sensor loose on pipe	Remount sensorUse Dow Corning Silicone #4					
Power interruption. No flow.	Check fuse/breaker. Confirm flow					
METER READING TOO HIGH						
Calibration error	• Review UNITS/MODE menu and Pipe					
Vibration or noise on the pipeline	• Install in another location.					
Pipe is not full	Remount Sensor on vertical pipe					
Nearby velocity increasing device (pump, valve, orifice plate)	 Relocate sensor >30 pipe diameters from velocity increasing device 					
Local electrical noise	• Ensure all Flowmeter wiring is in METAL conduit and sensor cable shield is connected to Ground stud					
Variable Speed Drive interference	 Follow Drive manufacturers wiring and Grounding instructions Relocate Flowmeter electronics, Sensor and wiring away from VSD 					




Possible Causes:	Corrective Action:
METER READING DOES NOT TRACK FLOW	
Sensor and GND wires reversed or not properly connected	Check Sensor connections
Improper AC power input Ground	• Use direct connection with 12 AWG wire to nearest Ground pole (<1 ohm resistance).

SENSOR CABLE RESISTANCE TEST

Unplug the green sensor terminal from the Doppler board and connect the sensor wires as shown. With a multimeter, perform resistance checks for each set of wires. One single loose terminal may cause false readings.

Test across shield and core of each wire: TMTR (black/white) and RCVR (black). Resistance should be around 82.5K ohms for any cable length. High readings indicate an open circuit and low readings indicate a short or partial short in the sensor cable.

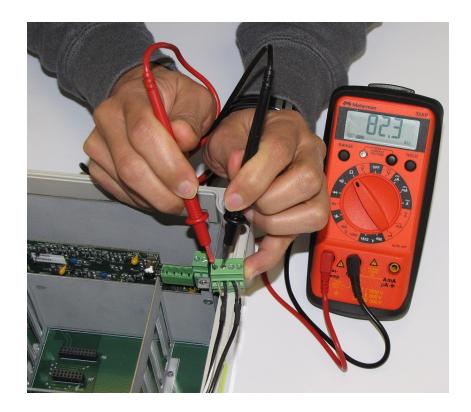



COMMON QUESTIONS AND ANSWERS

The pipe vibrates. Will it affect the flow meter?

Common vibration frequencies are far lower than the sonic frequencies used by the Greyline flow meter, and will not normally affect accuracy or performance. However, applications where very weak Doppler signal is present (when sensitivity is adjusted to maximum and signal strength is low), accuracy may be affected by pipe vibration, or the flow meter may show readings under no-flow conditions. Attempt to relocate the sensor on a pipe section where vibration is reduced, or arrange pipe mounting brackets to reduce vibration at the sensor mounting location.

The flow meter must be installed in a high noise environment. Will this affect operation?

Greyline flow meters are designed to discriminate between environmental noise and the Doppler signal. High noise environments may affect the flow meter's performance where low signal strength and/or low flow velocities are being measured. Relocate the sensor in a more quiet environment if possible.

Will pipe corrosion affect accuracy of the flow meter?

Yes. Rust, loose paint etc. must be removed from the outside of the pipe to provide a clean mounting position when installing a Doppler sensor. Severe corrosion/oxidation on the inside of the pipe may prevent the Doppler signal from penetrating into the flow. If the pipe cannot be cleaned, a spool piece (PVC recommended) should be installed for sensor mounting.

What effect do pipe liners have on the flow meter?

The air gap between loose insertion liners and the pipe wall prevent the Doppler signal from entering the flow. Better results can be expected with bonded liners such as cement, epoxy or tar, however an on site test is recommended to determine if the application is suitable for a Doppler flow meter.

Why is Doppler only recommended for liquids containing suspended solids or gases?

The Doppler sensor transmits sound into the flow stream which must be reflected back to the sensor to indicate flow velocity. Gas bubbles or suspended solids act as reflectors for the Doppler signal. As a guideline, Greyline Doppler flow meters are recommended for liquids containing solids or bubbles with a minimum size of 100 microns and a minimum concentration of 75 ppm. Most applications (except potable, distilled or deionized water) will meet this minimum requirement.

Can the sensor be submerged in water?

Yes, for short periods of time or by accident, but it is not recommended for continuous operation. The sensor is constructed to withstand submersion to 10 psi without damage, but external liquid moving in contact with the sensor can be interpreted as flow and cause false readings.

What is the purpose of the Signal Strength Display?

Doppler signals of very low strength are not accepted or processed by the instrument. This feature assists in rejection of environmental noise and vibration. Use the display to evaluate signal strength in your application. Strong signals will increase in percentage to a maximum of 100% or greater.



Can I change the length of the sensor cable?

Yes. Technological advances in Greyline Doppler design allow cable lengths up to 500 ft (152 m) with no loss of signal strength. Extended cable (Greyline Option DXC) should be installed in rigid or flexible conduit for mechanical protection. Use only Greyline shielded coaxial pair (RG174U) cable. Cable junctions should be made through a terminal block and housed in a watertight metal junction box (Greyline Option DJB). BNC coaxial connectors (TV cable type) are not recommended for cable splices.

Does the DFM 5.0 require periodic recalibration?

No. DFM 5.0 calibration does not drift over time. The solid state sensor has no moving parts to wear and affect calibration. The Doppler flow technique generates an ultrasonic signal proportional to the velocity of flow. All Greyline timing/counting circuits use crystal-controlled frequency references to eliminate any drift in the processing circuitry.



DFM 5.0 Doppler Flow Meter

APPLICATIONS HOTLINE

For applications assistance, advice or information on any Greyline Instrument contact your Sales Representative, write to Greyline or phone the Applications Hotline below:

United States:	Tel: 315-788-9500	Fax: 315-764-0419
Canada:	Tel: 613-938-8956	Fax: 613-938-4857
Toll Free:	888-473-9546	
Email:	info@greyline.com	
Web Site:	www.greyline.com	

Greyline Instruments Inc.

Canada 16456 Sixsmith Drive Long Sault, Ont. K0C 1P0 USA: 105 Water Street Massena, NY 13662



PRODUCT RETURN PROCEDURE

Instruments may be returned to Greyline for service or warranty repair.

1 Obtain an RMA Number from Greyline -

Before shipping a product to the factory please contact Greyline by telephone, fax or email to obtain an RMA number (Returned Merchandise Authorization). This ensures fast service and correct billing or credit.

When you contact Greyline please have the following information available:

- 1. Model number / Software Version
- 2. Serial number
- 3. Date of Purchase
- 4. Reason for return (description of fault or modification required)
- 5. Your name, company name, address and phone number

2 Clean the Sensor/Product -

Important: unclean products will not be serviced and will be returned to the sender at their expense.

1. Rinse sensor and cable to remove debris.

2. If the sensor has been exposed to sewage, immerse both sensor and cable in a solution of 1 part household bleach (Javex, Clorox etc.) to 20 parts water for 5 minutes. Important: do not immerse open end of sensor cable.

3. Dry with paper towels and pack sensor and cable in a sealed plastic bag.

4. Wipe the outside of the enclosure to remove dirt or deposits.

5. Return to Greyline for service.

3 Ship to Greyline -

After obtaining an RMA number please ship the product to the appropriate address below:

Canadian and International Customers:	USA Customers:
Greyline Instruments Inc. 16456 Sixsmith Drive Long Sault, Ont. KOC 1P0	Greyline Instruments Inc. 204 150th Avenue Madeira Beach, FL 33708
RMA#	RMA#



FLOW METER DATA SHEET

Please complete and retur	rn this form to Grevline. It is
important. We use this inf	formation to check our database
to you. Thanks for your ce	
Title/Dept.:	
Project:	
Fax:	
Cable Length:	
Type of Pump:	
	arge:
Power Input:	
Indication:	
Alarm:	
Output:	
Vertical	Horizontal
	for performance of Greyh applications, and to provi to you. Thanks for your co Title/Dept.: Project: Fax: Fax:



LIMITED WARRANTY

Greyline Instruments warrants, to the original purchaser, its products to be free from defects in material and workmanship for a period of one year from date of invoice. Greyline will replace or repair, free of charge, any Greyline product if it has been proven to be defective within the warranty period. This warranty does not cover any expenses incurred in the removal and re-installation of the product.

If a product manufactured by Greyline should prove defective within the first year, return it freight prepaid to Greyline Instruments along with a copy of your invoice.

This warranty does not cover damages due to improper installation or handling, acts of nature, or unauthorized service. Modifications to or tampering with any part shall void this warranty. This warranty does not cover any equipment used in connection with the product or consequential damages due to a defect in the product.

All implied warranties are limited to the duration of this warranty. This is the complete warranty by Greyline and no other warranty is valid against Greyline. Some states do not allow limitations on how long an implied warranty lasts or limitation of incidental or consequential damages, so the above limitations or exclusions may not apply to you.

This warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

Greyline Instruments Inc.




APPENDIX A – OPTIONS

EXTRA SENSOR CABLE (OPTION DXC)

Each Greyline flow meter includes 20 ft / 6m (or 50 ft / 15m optional) continuous shielded coaxial pair cable. Additional cable and Cable Junction Box (Option DJB) may be ordered with the Flow Meter, or the cable may be spliced and extended up to 500 ft (152m) as required during installation. No adjustment is required when the sensor cable is extended or shortened. Use only Greyline shielded coaxial pair (RG174U) cable.

Extended sensor cable should be installed in conduit for mechanical protection. Recommended installation with a metal junction box (Option DJB) is illustrated below:

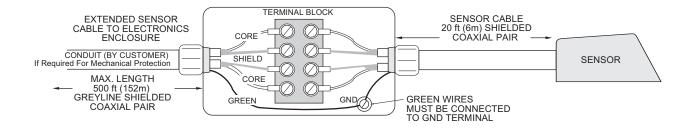

COAXIAL CABLE PREPARATION

DXC Doppler sensor cable can be cut and spliced up to a maximum length of 500 ft (152 m). Cable ends must be prepared as illustrated below.






SENSOR CABLE JUNCTION BOX (OPTION DJB)


Optional Watertight steel NEMA4 Junction Boxes with terminal strips are available from Greyline Instruments.

DIMENSIONS OPTION DJB - JUNCTION BOX

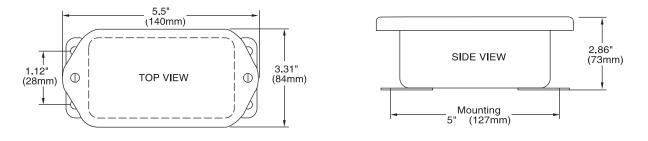

Velocity Sensor QZ02L-B

Minimum Velocity: Maximum Velocity:	0.1 ft/sec (0.03 m/sec) 20 ft/sec (6.2 m/sec)
Operating Temperature:	5 to 150°F (-15 to 65°C)
Exposed Materials:	PVC, epoxy resin, polyurethane, ultem
Sensor Cable:	25 ft. (7.6 m) submersible polyurethane jacket, shielded, 3 coaxial
Hazardous Rating:	CSA rated Intrinsically Safe Class I, Groups C,D, Class II, Groups E,F,G with optional Intrinsic Safety Barrier

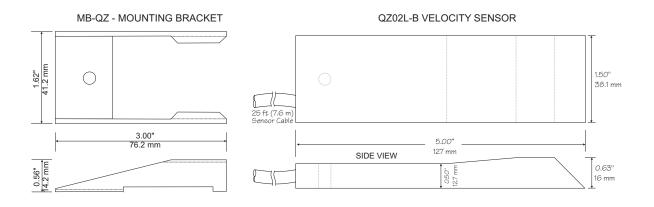



DFM 5.0 Doppler Flow Meter

SENSOR INTRINSIC SAFETY (OPTION 2ISB)

When connected through Intrinsic Safety Barriers, the Greyline Sensor Model SE4 is CSA certified for installation in a hazardous location rated:


Class I, Groups C,D Class II, Groups E,F,G Class III


Intrinsic Safety Barriers may be ordered with the Greyline instrument and are supplied mounted in the Greyline instrument enclosure. Replacement barrier fuses (Part No. ISB- 011239) may be purchased separately. The instrument enclosure containing the 2ISB Intrinsic Safety Barriers must be installed in a non-hazardous location.

Refer to SESPEC-INST-01 for complete installation instructions.

DRAWING NO: GN3SPEC-INST-02

DRAWING NO: GN3SPEC-INST-06

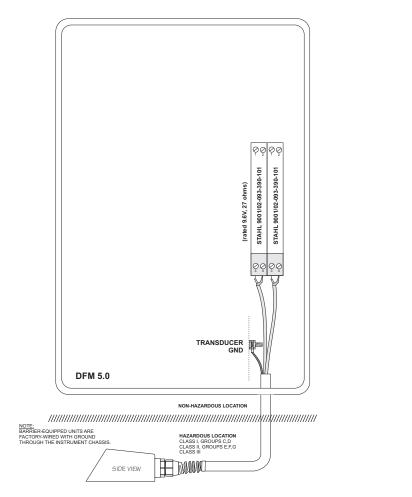

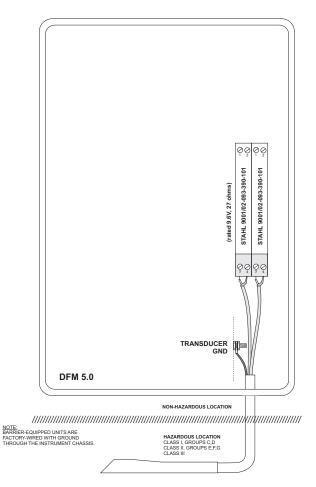




NON-INCENDIVE

With SE4 sensor installed in hazardous locations rated:

Class I, Division 2, Groups A,B,C&D

Intrinsic Safety Barriers are not required for SE4 sensor installation in Div 2. locations when properly connected to a DFM 5.0. The DFM 5.0 instrument enclosure must be installed in a nonhazardous location.

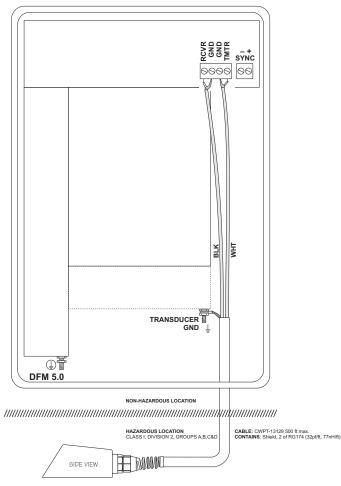


DRAWING NO: SESPEC-INST-02



ENCLOSURE HEATER AND THERMOSTAT - Option TH

Instruments can be factory-equipped with an Enclosure Heater and Thermostat or the module can be customer-installed. The Thermostat is factory set to turn ON at 40°F (4.5° C) and OFF at 60°F (15.5° C). Power consumption is 15 Watts.

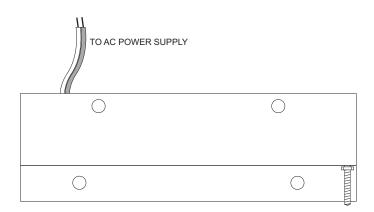

ENCLOSURE SUNSCREEN - Option SCR


Do not mount instrument electronics in direct sunlight. Overheating will reduce the life of electronic components and condensate may form during the heat/cool cycles and cause electrical shorts.

Note:

Exposure to direct sunlight can cause overheating and moisture condensation which will reduce the operating life of electronics.

Protect Instruments from direct sunlight with this iridite finished aluminum sun screen (Greyline Option SCR).

Seal conduit entries with caulking compound to further reduce moisture condensation.

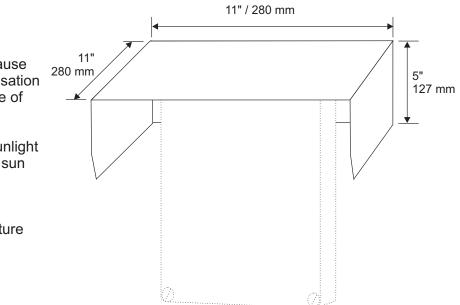



POWER INPUT OPTION 9-32VDC


DFM 5.0 Flow Meters may be ordered factory-configured for 9-32VDC power input.

QUICK BENCH TEST:

Connect Sensor as shown below, then Power. Test operation of the DFM 5.0 by holding the sensor in one hand and rubbing your thumb or fingers briskly across the face (plastic surface) of the sensor. Allow 15 seconds for the DFM 5.0 to process the signal and display a flow value.

CONNECTIONS:

POWER INPUT: Connect 9-32VDC to the + and - terminals. The Power Input GND terminal must be connected to the nearest Ground pole. A 1 amp fuse in line is recommended.

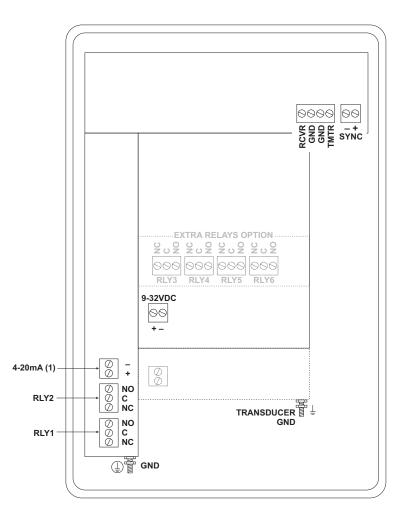



Data Logging									
▶Log Site ID 00									
	99								
Mode	Flow Velocity								
	Verocicg								
Set Date	Feb 18/2008								
	Mar 19/2009								
Set Time	11:27:40								
	12:28:41								
Interval	10sec								
	60min								
	30min								
	10min								
	5min								
	2min								
	1min								
	30sec								
Log	Stop								
	Start								
	Delete								

DATA LOGGING (Optional)

Setup

- Select Data Logging from Menu Selections.
- Log Site ID Enter a number from ØØ to 99. The site ID will become part of the downloaded file name to help distinguish downloads from different instruments. Press ✓ to store the setting.
 Mode Select Velocity (e.g. ft/sec or m/sec). Flow (e.g. USGPM or l/sec). Press ✓ to store the setting.
 Set Date Press ♠ or ♣ to scroll and select Month, Day and Year. Press
 - \checkmark to store the setting.
- Set Time Press \clubsuit or \clubsuit to select the current time in Hours, Minutes and Seconds. Press \checkmark to store the setting.
- Interval Press ♠ or ♣ to select the logging interval. Flow rate reading
 will be stored at each time interval. Press ✓ to store the
 setting.
 Note: Press ♣ to Log ♠ and ♠ or ♣ to Delete and ✓
 to delete the log file. Press ♠ and ♠ or ♣ to Start and
 ✓ to restart the logger.
 Log Stop, Start or Delete the log file. Delete old file
 - Stop, Start or Delete the log file. Delete old file and start a new log to apply any changes that have been made to the Log Site ID, Mode or Interval.

RETRIEVE LOG FILE

Plug a USB Flash Memory Drive (not supplied by Greyline) into the USB output cable from the instrument. The instrument display will show the message Downloading until the log file is transferred to the memory card and then display Completed. The USB flash drive may be removed.

Download file names will appear in this format:



Tag is set according to the Log Site ID entered in the instrument Data Logging menu.



Download letter will be A for the first download from an instrument. B for the second, then C etc. At the letter Z a - character will appear indicating that the maximum number of downloads for that instrument are on the USB flash drive. Older files can be erased or moved from the flash memory drive or a new memory drive can be used.

OPENING LOG FILES

Install Greyline Logger on your PC or laptop. Refer to the Help menu in the program for detailed instructions.

Select File/Open/Instrument Log (.log) to open the log file from your USB flash drive.




SPECIFICATIONS

EonioAnono		←	1
Flow Rate Range:	-40 to -0.25 ft/sec, +0.25 to +40 ft/sec (-12.2 to - 0.076 m/sec, +0.076 to +12.2 m/sec,) in most	6.46" / 164 mm	← 5.12" / 130 mm →
Pipe Size: Accuracy:	applications Any pipe ID from ½ " to 180" (12.7 mm to 4.5 m) ±2% of full scale. Requires solids or bubbles minimum size of		- 10.94" / 278 mm
Dicployee	100 microns, minimum concentration 75 ppm. Repeatability: ±0.1%, Linearity ±0.5% of full scale	DFM 5.0 Depair From Meter CONDUIT ENTRY	SIDE VIEW
Displays: Calibration:	White, backlit matrix - displays flow rate, totalizer, relay states, oper built-in 5-key calibrator wit		
Power Input:	selection 100-240VAC, 50/60Hz, 30 9-32VDC, 9 Watts max		
Output: Control Relays:	Isolated 4-20mA (1000 oh Qty 2, rated 5 amp 240VA proportional pulse	C SPDT, programmabl	
Enclosure: Environmental Conditions:	watertight, dust tight NEM shatter-proof face Relative humidity up to 80 maximum 5000 m altituda	% -23 to 60°C ambient	temperature,
Sensitivity: Electrical Surge Protection: Approximate Shipping Weight:	maximum 5000 m altitude, adjustable. Damping: adju Sensor, 4-20mA output an 10 lbs (4.5 kg)	stable	stanation Category II.

SE4 Doppler Sensor

Minimum Pipe Diameter: Maximum Pipe Diameter: Operating Temperature: Operating Frequency: Sensor Housing: Sensor Cable: 0.5" (12.5 mm) ID, 0.6" (15 mm) OD 180" (4.5 m) ID -40° to 300°F (-40° to 150°C) 640 KHz Stainless Steel 20 ft. (6 m) shielded coaxial pair (RG174U) Optional 50 ft (15 m) or 100 ft (30 m) continuous Withstands accidental submersion pressure up to 10 psi (0.7 Bar)

Submersion Rating:





APPENDIX B - CONVERSION TABLE

CONVERSION GUIDE									
FROM	то	MULTIPLY BY							
US GALLONS	CUBIC FEET	0.1337							
US GALLONS	IMPERIAL GALS	0.8327							
US GALLONS	LITRES	3.785							
US GALLONS	CUBIC METERS	0.003785							
LITRES/SEC	GPM	15.85							
LITRES	CUBIC METERS	0.001							
BARRELS	US GALLONS	42							
BARRELS	IMPERIAL GALS	34.9726							
BARRELS	LITRES	158.9886							
INCHES	ММ	25.4							
DEGREES F	DEGREES C	(°F-32) x 0.556							
POUNDS	KILOGRAMS	0.453							
PSI	BAR	0.0676							
FOOT ²	METER ²	0.0929							

Note: BARRELS are U.S. oil barrels.



PIPE CHARTS

Carbon Steel & PVC Pipe

Pipe	Pipe	Stan Schedi		Extra Sched		Dbl. I Hea		Sched	ule 10	Sched	ule 20	Schedule 30		Sched	nedule 40	
Size	0.D.	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	
1/2	.840	.622	.109	.546	.147	.252	.294							.622	.109	
1⁄4	1.050	.824	.113	.742	.154	.434	.308							.824	.113	
1	1.315	1.049	.133	.957	.179	.599	.358							1.049	.133	
1¼	1.660	1.380	.140	1.278	.191	.896	.382							1.380	.140	
11/2	1.900	1.610	.145	1.500	.200	1.100	.400							1.610	.145	
2	2.375	2.067	.154	1.939	.218	1.503	.436							2.067	.154	
21/2	2.875	2.469	.203	2.323	.276	1.771	.552							2.469	.203	
3	3.500	3.068	.216	2.900	.300	2.300	.600							3.068	.216	
31⁄2	4.000	3.548	.226	3.364	.318	2.728	.636							3.548	.226	
4	4.500	4.026	.237	3.826	.337	3.152	.674							4.026	.237	
5	5.563	5.047	.258	4.813	.375	4.063	.750							5.047	.258	
6	6.625	6.065	.280	5.761	.432	4.897	.864							6.065	.280	
8	8.625	7.981	.322	7.625	.500	6.875	.875			8.125	.250	8.071	.277	7.981	.322	
10	10.750	10.020	.365	9.750	.500	8.750	1.000			10.250	.250	10.136	.307	10.020	.365	
12	12.750	12.000	.375	11.750	.500	10.750	1.000			12.250	.250	12.090	.330	11.938	.406	
14	14.000	13.250	.375	13.000	.500			13.500	.250	13.376	.312	13.250	.375	13.124	.438	
16	16.000	15.250	.375	15.000	.500			15.500	.250	15.376	.312	15.250	.375	15.000	.500	
18	18.000	17.250	.375	17.000	.500			17.500	.250	17.376	.312	17.124	.438	16.876	.562	
20	20.000	19.250	.375	19.000	.500			19.500	.250	19.250	.375	19.000	.500	18.814	.593	
22	22.000	21.250	.375	21.000	.500			21.500	.250	21.250	.375	21.000	.500			
24	24.000	23.250	.375	23.000	.500			23.500	.250	23.250	.375	22.876	.562	22.626	.687	
26	26.000	25.250	.375	25.000	.500			25.376	.312	25.000	.500					
28	28.000	27.250	.375	27.000	.500			27.376	.312	27.000	.500	26.750	.625			
30	30.000	29.250	.375	29.000	.500			29.376	.312	29.000	.500	28.750	.625			
32	32.000	31.250	.375	31.000	.500			31.376	.312	31.000	.500	30.750	.625			
34	34.000	33.250	.375	33.000	.500			33.376	.312	33.000	.500	32.750	.625			
36	36.000	35.250	.375	35.000	.500			35.376	.312	35.000	.500	34.750	.625			
42	42.000	41.250	.375	41.000	.500					41.000	.500	40.750	.625			

Ductile Iron Pipe - Standard Classes

Size	OUTSIDE	Class		CEMENT	LINING												
INCH	DIA.	50		51		52		53		54		55		56		**STD	**DOUBLE
	INCH	WALL	I.D.	THICKNESS	THICKNESS												
3	3.96			0.25	3.46	0.28	3.40	0.31	3.34	0.34	3.28	0.37	3.22	0.41	3.14		
4	4.80			0.26	4.28	0.29	4.22	0.32	4.16	0.35	4.10	0.38	4.04	0.44	3.93		
6	6.90	0.25	6.40	0.28	6.34	0.31	6.28	0.34	6.22	0.37	6.16	0.40	6.10	0.43	6.04	.125	.250
8	9.05	0.27	8.51	0.30	8.45	0.33	8.39	0.36	8.33	0.39	8.27	0.42	8.21	0.45	8.15		
10	11.10	0.39	10.32	0.32	10.46	0.35	10.40	0.38	10.34	0.41	10.28	0.44	10.22	0.47	10.16		
12	13.20	0.31	12.58	0.34	12.52	0.37	12.46	0.40	12.40	0.43	12.34	0.46	12.28	0.49	12.22		
14	15.30	0.33	14.64	0.36	14.58	0.39	14.52	0.42	14.46	0.45	14.40	0.48	14.34	0.51	14.28		
16	17.40	0.34	16.72	0.37	16.66	0.40	16.60	0.43	16.54	0.46	16.48	0.49	16.42	0.52	16.36		
18	19.50	0.35	18.80	0.38	18.74	0.41	18.68	0.44	18.62	0.47	18.56	0.50	18.50	0.53	18.44	.1875	.375
20	21.60	0.36	20.88	0.39	20.82	0.42	20.76	0.45	20.70	0.48	20.64	0.51	20.58	0.54	20.52		
24	25.80	0.38	25.04	0.41	24.98	0.44	24.92	0.47	24.86	0.50	24.80	0.53	24.74	0.56	24.68		
30	32.00	0.39	31.22	0.43	31.14	0.47	31.06	0.51	30.98	0.55	30.90	0.59	30.82	0.63	30.74		
36	38.30	0.43	37.44	0.48	37.34	0.62	37.06	0.58	37.14	0.63	37.04	0.68	36.94	0.73	36.84		
42	44.50	0.47	43.56	0.53	43.44	0.59	43.32	0.65	43.20	0.71	43.08	0.77	42.96	0.83	42.84	.250	.500
48	50.80	0.51	49.78	0.58	49.64	0.65	49.50	0.72	49.36	0.79	49.22	0.86	49.08	0.93	48.94		
54	57.10	0.57	55.96	0.65	55.80	0.73	55.64	0.81	55.48	0.89	55.32	0.97	55.16	1.05	55.00		

**REDUCE I.D. BY DIMENSION SHOWN



Pipe	Pipe	Schedule 5 S (a)		Schedul	e 10 S (a)	Schedu	le 40 S	Schedule 80 S		
Size	0.D.	I.D.	WALL	I.D.	I.D. WALL		WALL	I.D.	WALL	
1/2	.840	.710	.065	.674	.083	.622	.109	.546	.147	
1⁄4	1.050	.920	.065	.884	.083	.824	.113	.742	.154	
1	1.315	1.185	.065	1.097	.109	1.049	.133	.957	.179	
1¼	1.660	1.530	.065	1.442	.109	1.380	.140	1.278	.191	
11/2	1.900	1.770	.065	1.682	.109	1.610	.145	1.500	.200	
2	2.375	2.245	.065	2.157	.109	2.067	.154	1.939	.218	
21/2	2.875	2.709	.083	2.635	.120	2.469	.203	2.323	.276	
3	3.500	3.334	.083	3.260	.120	3.068	.216	2.900	.300	
31/2	4.000	3.834	.083	3.760	.120	3.548	.226	3.364	.318	
4	4.500	4.334	.083	4.260	.120	4.026	.237	3.826	.337	
5	5.563	5.345	.109	5.295	.134	5.047	.258	4.813	.375	
6	6.625	6.407	.109	6.357	.134	6.065	.280	5.761	.432	
8	8.625	8.407	.109	8.329	.148	7.981	.322	7.625	.500	
10	10.750	10.482	.134	10.420	.165	10.020	.365	9.750	.500	
12	12.750	12.438	.156	12.390	.180	12.000	.375	11.750	.500	
14	14.000	13.688	.156	13.624	.188					
16	16.000	15.670	.165	15.624	.188					
18	18.000	17.670	.165	17.624	.188					
20	20.000	19.634	.188	19.564	.218					
22	22.000	21.624	.188	21.564	.218					
24	24.000	23.563	.218	23.500	.250					

Stainless Steel, Hastelloy "C" & Titanium Pipe

Pipe	Pipe	Schedule 60		Schedule 80		Schedu	le 100	Schedu	ule 120	Schedule 140		Schedule 160	
Size	0.D.	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL
1/2	.840			.546	.147							.466	.187
1⁄4	1.050			.742	.154							.614	.218
1	1.315			.957	.179							.815	.250
1¼	1.660			1.278	.191							1.160	.250
11/2	1.900			1.500	.200							1.338	.281
2	2.375			1.939	.218							1.689	.343
21/2	2.875			2.323	.276							2.125	.375
3	3.500			2.900	.300							2.624	.438
31/2	4.000			3.364	.318								
4	4.500			3.826	.337			3.624	.438			3.438	.531
5	5.563			4.813	.375			4.563	.500			4.313	.625
6	6.625			5.761	.432			5.501	.562			5.189	.718
8	8.625	7.813	.406	7.625	.500	7.439	.593	7.189	.718	7.001	.812	6.813	.906
10	10.750	9.750	.500	9.564	.593	9.314	.718	9.064	.843	8.750	1.000	8.500	1.125
12	12.750	11.626	.562	11.376	.687	11.064	.843	10.750	1.000	10.500	1.125	10.126	1.312
14	14.000	12.814	.593	12.500	.750	12.126	.937	11.814	1.093	11.500	1.250	11.188	1.406
16	16.000	14.688	.656	14.314	.843	13.938	1.031	13.564	1.218	13.124	1.438	12.814	1.593
18	18.000	16.500	.750	16.126	.937	15.688	1.156	15.250	1.375	14.876	1.562	14.438	1.781
20	20.000	18.376	.812	17.938	1.031	17.438	1.281	17.000	1.500	16.500	1.750	16.064	1.968
22	22.000	20.250	.875	19.750	1.125	19.250	1.375	18.750	1.625	18.250	1.875	17.750	2.125
24	24.000	22.064	.968	21.564	1.218	20.938	1.531	20.376	1.812	19.876	2.062	19.314	2.343



Cast Iron Pipe - ASA Standard

Pipe	Pipe	Class 50		Class 100		Class 150		Class 200		Class 250		Class 300		Class 350	
Size	0.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.	WALL	I.D.
3	3.96	0.32	3.32	0.32	3.32	0.32	3.32	0.32	3.32	0.32	3.32	0.32	3.32	0.32	3.32
4	4.80	0.35	4.10	0.35	4.10	0.35	4.10	0.35	4.10	0.35	4.10	0.35	4.10	0.35	4.10
6	6.90	0.38	6.14	0.38	6.14	0.38	6.14	0.38	6.14	0.38	6.14	0.38	6.14	0.38	6.14
8	9.05	0.41	8.23	0.41	8.23	0.41	8.23	0.41	8.23	0.41	8.23	0.41	8.23	0.41	8.23
10	11.10	0.44	10.22	0.44	10.22	0.44	10.22	0.44	10.22	0.44	10.22	0.48	10.14	0.52	10.06
12	13.20	0.48	12.24	0.48	12.24	0.48	12.24	0.48	12.24	0.52	12.16	0.52	12.16	0.56	12.08
14	15.30	0.48	14.34	0.51	14.28	0.51	14.28	0.55	14.20	0.59	14.12	0.59	14.12	0.64	14.02
16	17.40	0.54	16.32	0.54	16.32	0.54	16.32	0.58	16.24	0.63	16.14	0.68	16.04	0.68	16.04
18	19.50	0.54	18.42	0.58	18.34	0.58	18.34	0.63	18.24	0.68	18.14	0.73	18.04	0.79	17.92
20	21.60	0.57	20.46	0.62	20.36	0.62	20.36	0.67	20.26	0.72	20.16	0.78	20.04	0.84	19.92
24	25.80	0.63	24.54	0.68	24.44	0.73	24.34	0.79	24.22	0.79	24.22	0.85	24.10	0.92	23.96

Cast Iron Pipe - AWWA Standard

Pipe	Class A 100 Ft. 43 PSIG			Class B 200 Ft. 86 PSIG				Class C Ft. 130		Class D 400 Ft. 173 PSIG			
Size	0.D.	WALL	I.D.	0.D.	WALL	I.D.	0.D.	WALL	I.D.	0.D.	WALL	I.D.	
3	3.80	0.39	3.02	3.96	0.42	3.12	3.96	0.45	3.06	3.96	0.48	3.00	
4	4.80	0.42	3.96	5.00	0.45	4.10	5.00	0.48	4.04	5.00	0.52	3.96	
6	6.90	0.44	6.02	7.10	0.48	6.14	7.10	0.51	6.08	7.10	0.55	6.00	
8	9.05	0.46	8.13	9.05	0.51	8.03	9.30	0.56	8.18	9.30	0.60	8.10	
10	11.10	0.50	10.10	11.10	0.57	9.96	11.40	0.62	10.16	11.40	0.68	10.04	
12	13.20	0.54	12.12	13.20	0.62	11.96	13.50	0.68	12.14	13.50	0.75	12.00	
14	15.30	0.57	14.16	15.30	0.66	13.98	15.65	0.74	14.17	15.65	0.82	14.01	
16	17.40	0.60	16.20	17.40	0.70	16.00	17.80	0.80	16.20	17.80	0.89	16.02	
18	19.50	0.64	18.22	19.50	0.75	18.00	19.92	0.87	18.18	19.92	0.96	18.00	
20	21.60	0.67	20.26	21.60	0.80	20.00	22.06	0.92	20.22	22.06	1.03	20.00	
24	25.80	0.76	24.28	25.80	0.89	24.02	26.32	1.04	24.22	26.32	1.16	24.00	
30	31.74	0.88	29.98	32.00	1.03	29.94	32.40	1.20	30.00	32.74	1.37	30.00	
36	37.96	0.99	35.98	38.30	1.15	36.00	38.70	1.36	39.98	39.16	1.58	36.00	
42	44.20	1.10	42.00	44.50	1.28	41.94	45.10	1.54	42.02	45.58	1.78	42.02	
48	50.50	1.26	47.98	50.80	1.42	47.96	51.40	1.71	47.98	51.98	1.96	48.06	
54	56.66	1.35	53.96	57.10	1.55	54.00	57.80	1.90	54.00	58.40	2.23	53.94	
60	62.80	1.39	60.02	63.40	1.67	60.06	64.20	2.00	60.20	64.82	2.38	60.06	
72	75.34	1.62	72.10	76.00	1.95	72.10	76.88	2.39	72.10				
84	87.54	1.72	84.10	88.54	2.22	84.10							

Pipe	Class E 500 Ft. 217 PSIG			Class F 600 Ft. 260 PSIG			700	Class G Ft. 304		Class H 800 Ft. 347 PSIG			
Size	0.D.	WALL	I.D.	0.D.	WALL	I.D.	0.D.	WALL	I.D.	0.D.	WALL	I.D.	
6	7.22	0.58	6.06	7.22	0.61	6.00	7.38	0.65	6.08	7.38	0.69	6.00	
8	9.42	0.66	8.10	9.42	0.71	8.00	9.60	0.75	8.10	9.60	0.80	8.00	
10	11.60	0.74	10.12	11.60	0.80	10.00	11.84	0.86	10.12	11.84	0.92	10.00	
12	13.78	0.82	12.14	13.78	0.89	12.00	14.08	0.97	12.14	14.08	1.04	12.00	
14	15.98	0.90	14.18	15.98	0.99	14.00	16.32	1.07	14.18	16.32	1.16	14.00	
16	18.16	0.98	16.20	18.16	1.08	16.00	18.54	1.18	16.18	18.54	1.27	16.00	
18	20.34	1.07	18.20	20.34	1.17	18.00	20.78	1.28	18.22	20.78	1.39	18.00	
20	22.54	1.15	20.24	22.54	1.27	20.00	23.02	1.39	20.24	23.02	1.51	20.00	
24	26.90	1.31	24.28	26.90	1.45	24.00	27.76	1.75	24.26	27.76	1.88	24.00	
30	33.10	1.55	30.00	33.46	1.73	30.00							
36	39.60	1.80	36.00	40.04	2.02	36.00							